28 October 2022 Project No: LTC22215

Attention: Chloe McConochie Gould Developments Limited

RE:



LandTech Consulting Ltd

Auckland Office: 09 930 9334

9B Collard Place, Henderson Christchurch Office: 03 390 1371 11B Carlyle Street, Sydenham

Postal: PO Box 119, Christchurch 8013

Email: info@landtech.nz

SHALLOW SOIL TEST REPORT LOT 194, 138 & 5/144 DUNNS CROSSING ROAD

1.0 Introduction & Background

www.landtech.nz

LandTech Consulting Limited (LandTech) were engaged by Gould Developments Limited to carry out lot specific shallow soil testing for the subdivision at 138 & 5/144 Dunns Crossing Road. This shallow soil test report is for Lot 194 of the subdivision herein referred to as the site. The purpose of the shallow soil testing is to confirm subsurface conditions and provide geotechnical recommendations with regards to future residential foundations within the site.

2.0 Shallow Soil Testing

LandTech investigated the site on 26 October 2022, comprising two hand auger holes with corresponding Scala Penetrometer tests and two additional Scala Penetrometer tests. The test locations were measured from lot boundaries and/or surveyed centre pegs and are approximate only. The test locations are shown on the LandTech *Test Location Plan*, Drawing No. Lot 194/ TLP attached to this report.

The soil conditions encountered within the hand auger holes were logged by LandTech technical staff in accordance with New Zealand Geotechnical Society *Guideline for the Description of Soil and Rock for Engineering Purposes* (2005). The hand auger logs are attached to this report.

The Dynamic Cone (Scala) Penetrometer testing procedure was carried out in accordance with NZS 4402:1988, Test 6.5.2, *Dynamic Cone Penetrometer*. The Scala penetrometer test results are attached to this report.

The hand auger holes encountered topsoil/fill material from the ground surface to approximately 0.2m depths, underlain by inferred natural gravel. Groundwater was not encountered during testing. Scala Penetrometer testing at each of the four locations returned results between 4 and 40+ blows per 100mm penetration at the test positions, encountering refusal at depths between 0.5m and 0.6m below present ground level.

The two hand auger holes were carried out at either end of the lot; therefore, ground conditions could vary away from the test positions. Additionally, the tests refused within placed topsoil and inferred underlying natural ground. This bears the potential for greater depths of unsuitable topsoil and fill than those encountered within our hand augers, which should be considered during earthworks and foundation excavations.

3.0 Foundation Recommendations

We have previously investigated the site at 138 & 5/144 Dunns Crossing Road as part of a proposed subdivision investigation. The corresponding report is titled *Geotechnical Investigation Report for Proposed Residential Subdivision, 138 Dunns Crossing Road, Rolleston,* project reference: LTC20416, Revision A, dated 17 September 2021. The report classified the land as equivalent TC1, indicating the proposed new foundations are likely to be constructed in accordance with the NZS 3604: 2011 (i.e. light timber framed one or two story construction), subject to lot specific testing at the Building Consent stage.

From the lot-specific investigation for the site we conclude the site has "Good Ground", and that dwelling foundations on this site can comprise NZS3604:2011 type foundations or codemark approved concrete slab foundations that are applicable for the site conditions (i.e. "good ground"). All foundations must be embedded to a minimum depth of 0.2m below ground level, into the underlying Natural Gravel or Engineered Fill. At these depths, either "Good Ground" or an Ultimate Bearing Capacity of 300kPa is available/inferred. If specific engineering design is being carried out a strength reduction factor of ϕ =0.5 should be used. This depth has been supplied based on ground level at the time of testing. All topsoil and unsuitable materials should be removed below foundations and floor slab areas.

The subgrade should be inspected by a suitably qualified structural or geotechnical engineer or suitably experienced building inspector to confirm founding conditions meet the requirements of NZS3604:2011 "Good Ground".



SHALLOW SOIL TESTING REPORT LANDTECH CONSULTING LIMITED 28 OCTOBER 2022

4.0 Limitations

This shallow soil testing report has been prepared for our client, Gould Developments Limited. This report shall not be extrapolated for other nearby sites or used for any other purposes without the express approval of LandTech and their client.

This report has been based on the results of tests at point locations; therefore, subsurface conditions could vary away from the assumed geotechnical model. Should exposed soil conditions vary from those described herein we request to be informed to determine the continued applicability of our recommendations. We have attempted to conduct a thorough investigation of soil types across the site, within the agreed scope of works. However, variations still may exist as soils can vary naturally and due to previous human activities, which LandTech have no control over and should not be held accountable for.

The geotechnical investigation was confined to geotechnical aspects of the site only and did not involve the assessment for environmental contaminants. In addition, our investigation and analyses have also not taken into account possible fault rupture that may cause deformations and displacements of the ground directly below the site. This type of assessment is outside of the scope of our geotechnical engagement.

If you have any queries regarding this report, please contact the undersigned at your convenience.

Yours faithfully, LandTech Consulting Limited

Prepared By:

Kristen Bullen – Engineering Geologist BSc (Geology)

Authorised By:

ma won

Dwayne Wilson - Director CMEngNZ, CPEng, IntPE(NZ)

Attachments: Test Location Plan Test Results

SHALLOW SOIL TESTING REPORT LANDTECH CONSULTING LIMITED 28 OCTOBER 2022





⊕_{HA01} LandTech Consulting Ltd. augerhole locations, drilled 26 October 2022

LandTech Consulting Ltd. DCP test location, tested 26 October 2022 SP01

North

Proposed boundary

NOTES:

DATE


REV 26/10/2022 A Report Issue


Locations of features approximate only

Original sheet size A3

Boundary information on this *Test Location Plan* adapted from Patterson Pitts Group Drawing titled Engineering Drawings Gould Developments 138 & 5/144 Dunns Crossing Stages 6 & 7

DESCRIPTION

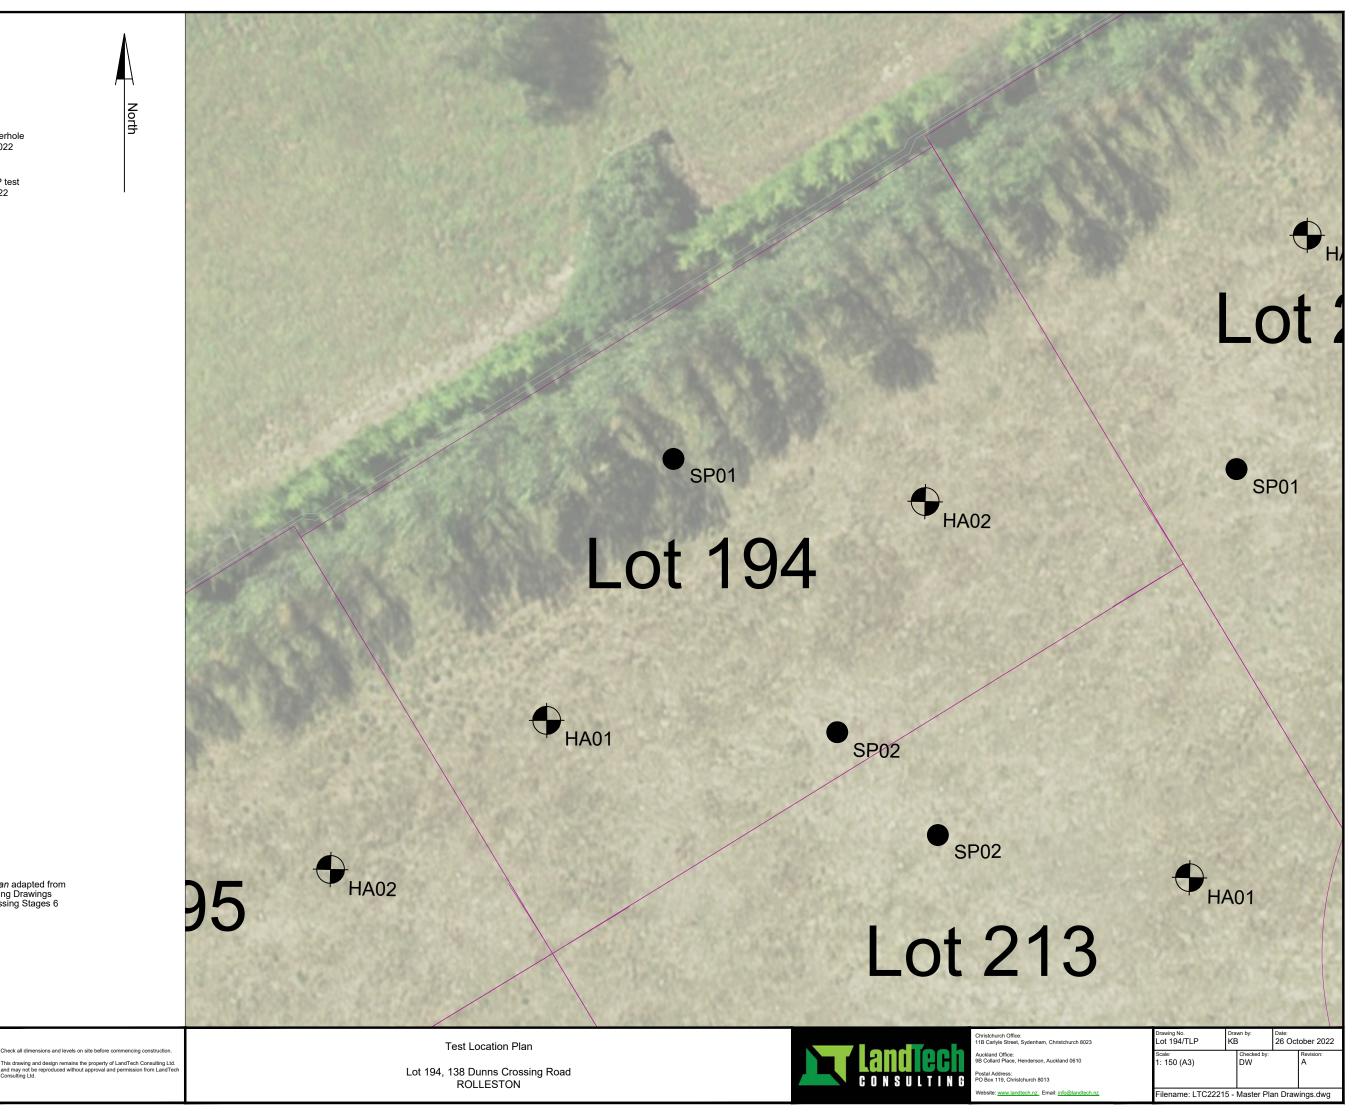

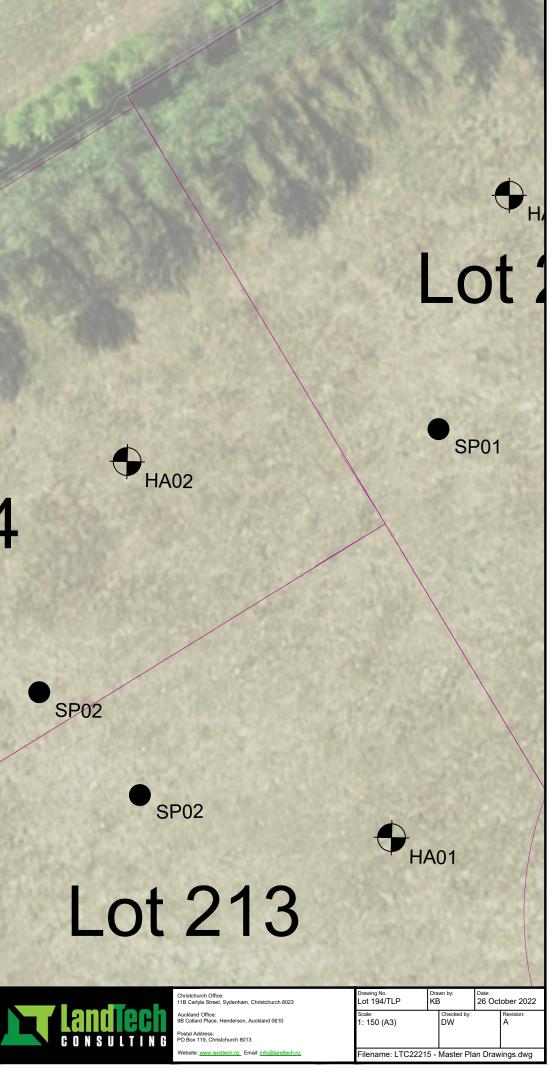

		and	looh		Goulds Devel	opments Limit	ed							Auge	erhole I	No.: L	ot 194	i - HA	01
Ь	C	ONSUI	TINC	-	Lot Specifics 138 & 5/144 E	Ounns Crossin	ıq, Rolleston								Sheet I	No.: 1	of 1		
	/pe: tarted	LTC22 50mm : 26-Oct d: 26-Oct	2215 Hand Auger t-22			Coordinate Reduced Lo Ground Co	es: evel:	NZTM2000: 42.50m (LVI Near Level, Not Encount	D137) Fill	158.89,	N5170	025.67		Calibra Calibra	Vane N ation Fa ation Da	actor: ate:			KB
ЪЧ	e	Бo			Deer				er ((Shea	r Streng		-situ Fiel	d Testing nic Cone		a) Pene	trome	ter
Stratigraphy	Depth (m)	Graphic Log	Soil description in	accordance w Enginee		Field Classification Geotechnical Societ	and Description of S ty Inc, 2005	oil and Rock for	Groundwater Level (m)	Depth (m)	● Pea ● Rei			Depth (m)	w Count		ila Blow 100n	/ Cour hm	
Topsoil / Fill	-		Fine to mediu sand, brown, v	ım subrour very stiff, c	d to rounded (lry, non-plastic	gravelly SILT, c, [ENGINEER	some fine to m RED FILL].	ledium		_				-0.1 -0.2	8 11		٩		
	-		-		End of Aug	gerhole: 0.2m				-				-0.3	16				
	-				[TOO DENS	E TO AUGER	R]			-				-0.4	27				٩
	-									-									7
	0.5 _									0.5 _				-0.5	40				
	-									-									
	_									_									
	-																		
	-									-									
	1.0 _									1.0 _									
	-									-									
	-									_									
	_																		
	-																		
	1.5 _									1.5 _									
	-									-									
	-									-									
	-									_									
	-									_									
	2.0 _									2.0 _									
	-									-									
	-									-									
	-									-									
	-									-									
	2.5 _									2.5 _									
	_																		
	-																		
	-									-									
	-									-									
	-									-									
Inf									In- situ testin	g inaccorda	ance with the	following sta	indards;						
Inferred (gravels								Scala Penet	rometer Tes	sting: NZS 4	402:1988, Te	est 6.5.2, Dynan ear Vane Test,						
			LandTech Consultin	ing Ltd: 11B Ca	arlyle Street, Sydenh	nam Christchurch, 8	023		Ph: 03 39				,	Email: info Website: w	@landtech	.nz ch.nz			

		ond	Client: Goulds Developments Limited Project: Lot Specifics				Augerhole N	lo.: Lot 194 - HA02
	C	ONSUI	CUING Project: Lot Specifics Address: 138 & 5/144 Dunns Crossing, Rolleston				Sheet N	lo.: 1 of 1
	ype: started	LTC22 50mm : 26-Oct d: 26-Oct	2215 Coordinates: NZTM200 a Hand Auger Reduced Level: 42.50m (i st-22 Ground Conditions: Near Lev	LVD137) el, Fill	073.91	, N5170034.35	Logged By: Shear Vane No Calibration Fa Calibration Da	KB c.: ctor:
2	_	b		Ŀ		In Shear Strength (kPa)	-situ Field Testing	(Scala) Penetrometer
Stratigraphy	Depth (m)	Graphic Log	Description Soil description in accordance with Guideline for the Field Classification and Description of Soil and Rock for Engineering Purposes, NZ Geotechnical Society Inc, 2005	Groundwater Level (m)	Depth (m)	Peak Remoulded 50 100 150 200	oth (m) w Count	Scala Blow Count / 100mm 0 5 10 15 20
/ Fill			SILT, some fine to medium subround to rounded gravel, minor fine sand, brown, very stiff, dry, non-plastic, [ENGINEERED FILL].				-0.1 10	
Topsoil / Fill	-				·		-0.2 13	₹.
	-		End of Augerhole: 0.2m	-	.		-0.3 14	Þ
	-		[TOO DENSE TO AUGER]					L.
	-						-0.4 24	
	0.5 _				0.5		-0.5 40	
	0.5 _				0.0			
	-				.			
	-				.			
	-				.			
	_							
	1.0 _				1.0			
	-							
	-				.			
	-							
	-				·			
	1.5 _				1.5 _			
	-							
	-				.			
	_							
	-							
	2.0 _				2.0			
	-							
	-							
	-				.			
	-				.			
	2.5 _				2.5 _			
	-							
	-				·			
	-				.			
<u> </u>				<u>In-s</u> itu test	ing inaccord	ance with the following standards:		
Inferred	gravels							
			LandTech Consulting Ltd: 11B Cartyle Street Systembarn Christehurch 8023	1		alaaline toi i taitu metu aitear vane Test,	Email: info@landtech.	nz
			Land recht Consulting Ltu. 1 To Ganyle Street, Sydennam Christichuffch, 8023	Pn: 03 39	50 13/1		Website: www.landtec	h.nz

			ndTech		t: Lot Spe													
	Lot 194 - SP01							ossing, Rolleston Lot 194 - SP02										
	Ground Conditions: Near Level, Fill Coordinates: NZTM2000 E 1549063.92 N 5170036.04					Gr Co	Tested By: KB Ground Conditions: Near Level, Fill Coordinates: NZTM2000 E 1549070.42 N 5170025.20					0.42	Coord	nd Conditions: Jinates:	Ċ	Tested By: Ground Conditions: Coordinates:		
		Test Date: 26-Oct-22			Te	Test Date: 26-Oct-22					Ê	Test D	Date:	Т	Test Date:			
		DATA	SCA م م م م م	L A PENET (Blows / 100 <u> </u>	0mm)		DATA	SCA - ۲ ۳ ۳ ۳		/ 100mm)		-16 -17 -18	DEPTH (m)	рата	SCALA PENETROMETER (Blows / 100mm) 도 직 후 적 약 약 두 후 후 후 두 두 두 두 두 두 두 후 후	DATA	SCALA PENETROMETER (Blows / 100mm) 두 작 한 작 약 약 수 약 한 약 두 약 약 약 약 약 약 약 약 약	DEPTH (m)
-	_	4	1				18					1						
_ 0	.2 _	9		>			24						_ 0.2 _					0.2
	.4 _	6 9	×				40						_ 0.4 _					_ 0.4 _
F.	_	15																
	.6	40											0.6					0.6
_ 0	.8												_ 0.8 _					_ 0.8 _
F	_																	
- 1	.2 _												_ 1.2 _					_ 1.2 _
	.4 _												_ 1.4 _					
12:01	_																	
1	.6												1.6					1.6
- 28/10/2	.8 _												_ 1.8 _					1.8
ug2021.	0																	
ults_12A																		
<u> </u>	.2 _												_ 2.2 _					_ 2.2 _
eroc - Scal	.4												_ 2.4 _					
GS by G	_																	
th core-gs by	.6												2.6					2.6
	.8												_ 2.8 _					_ 2.8 _
Genera	_																	